



DATE: 2023-02-02


MODEL: SR1/SR3

FUEL RAIL FIXING

PRIORITY –HIGH (ACTION)

Following an assembly issue from one of our suppliers, all customers are advised to check the fixing of the Fuel Rail bolts.

As a precaution it is advised to check all cars delivered since January 1st 2022.

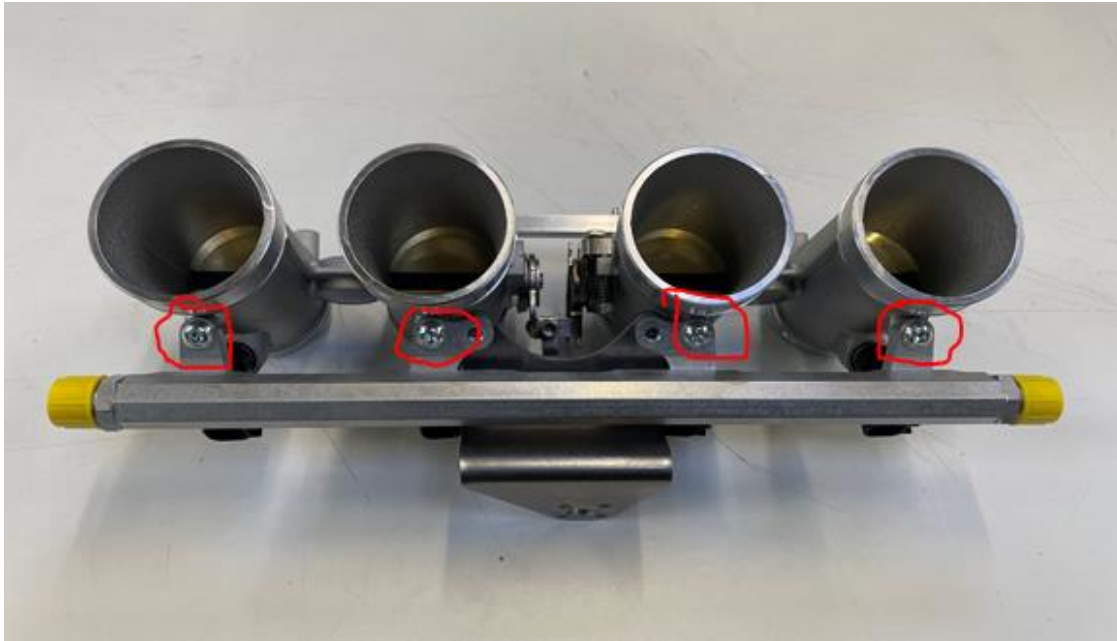

Tools required for procedure:

- Torque wrench set to 7Nm
- 4mm Hex socket / Key
- Loctite 243

Procedure:

Step 1 - Undo one fuel rail mounting screw with the 4mm Hex key - check for blue Loctite.

Step 2 – If no Loctite is found, Loctite 243 to M6x12 button head (thread end). Screw in and torque to 7Nm.

Step 3 - Repeat for all 4 Bolts



Technical Department
Radical Sportscars



RADICAL