



DATE: 2023-05-24


MODEL: SR3 XXR/SR10

PEDAL POSITION SENSOR WATER INGRESS


PRIORITY – HIGH (ACTION)

In extreme wet conditions water ingress has been found into the Pedal Position Sensor (ET0072). This can cause electrical issues. To prevent this issue customers are advised to apply the following reliability modification:

1. Remove the PPS from the car.
2. Place the PPS on bench or lock in vice to have good access to the wiring coming out of the sensor.
3. Carefully remove all silicone and trim the excessive heat shrink sticking out of the sensor.

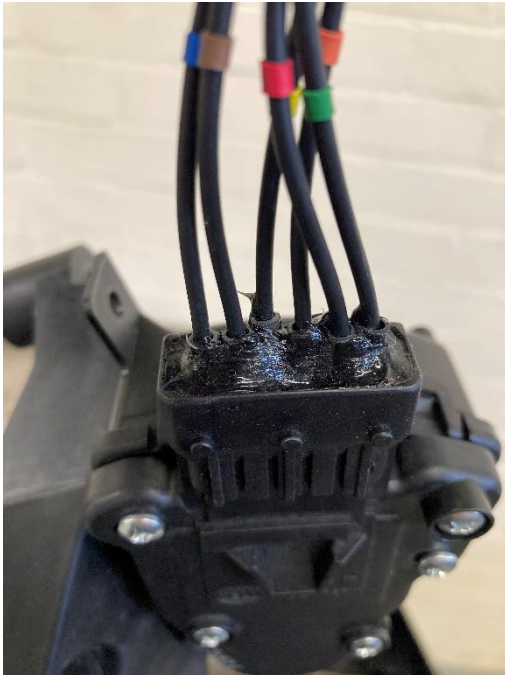

4. To confirm the sensor is fully functional and no connections have been disturbed plug the unit back into the car and check functionality using LifeMon or dashboard.

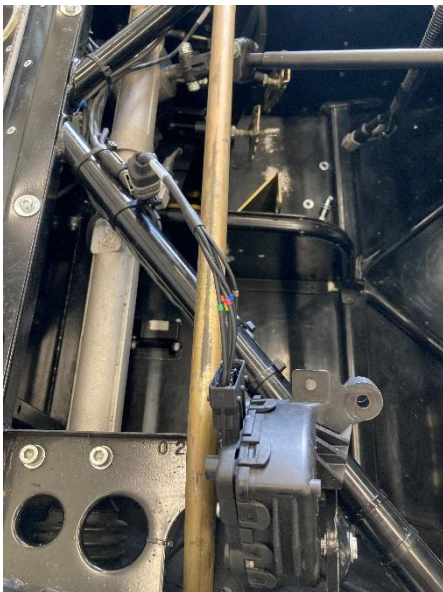

5. Re-pot the sensor using silicone or alternative potting compound, be sure to cover entire space around the wiring.
6. Let it dry in stable position before re-installing to the car.

